


Rev.	Date	Description

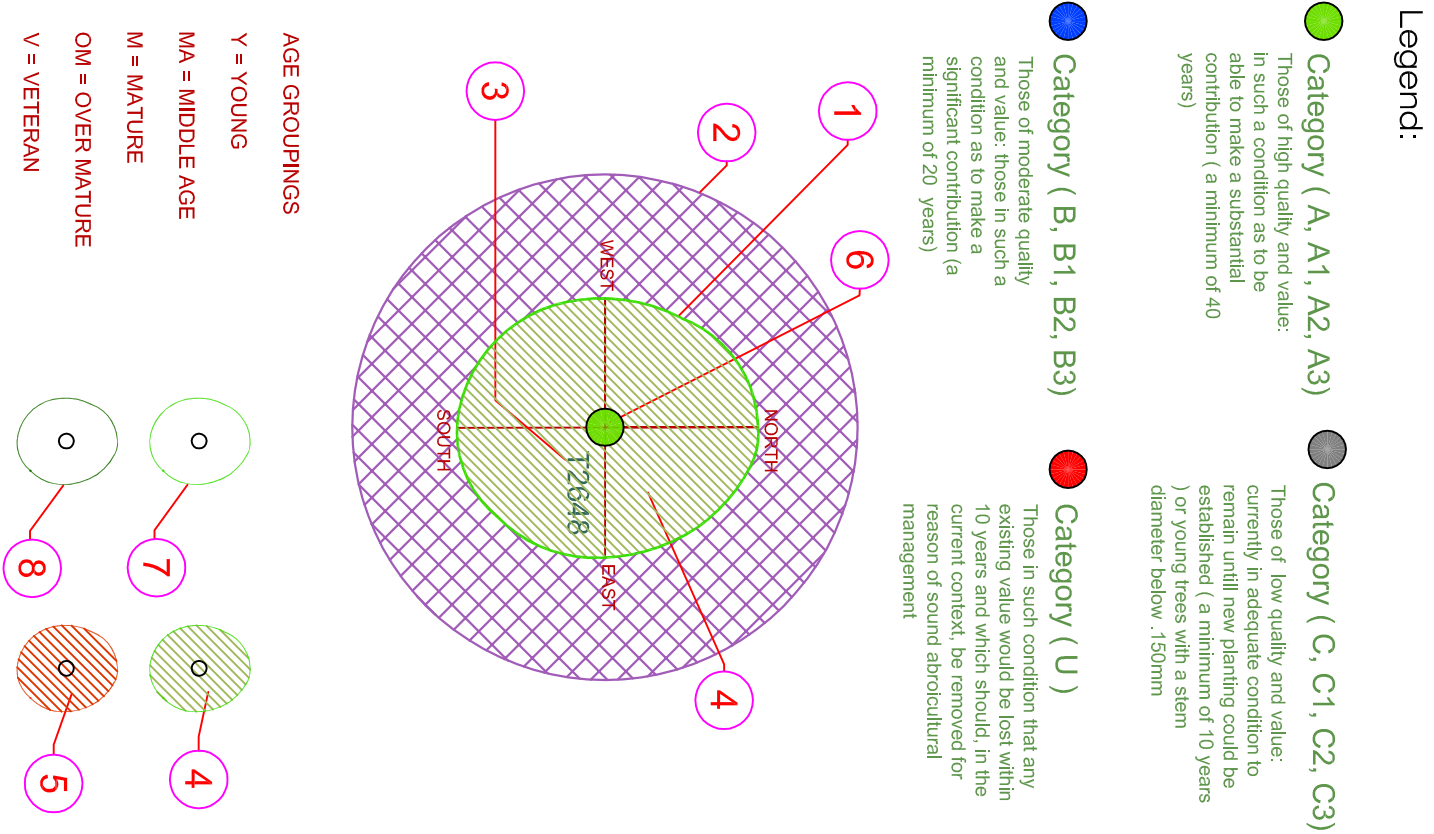

- EXISTING TREE CANOPY BASED ON DIMENSIONS GATHERED ON SITE IN 4 DIRECTIONS, NORTH, SOUTH, EAST AND WEST
 - ROOT PROTECTION ZONE BASED ON 12 TIMES THE DBH/AT CHEST HEIGHT
 - TREE TAG NUMBER
 - TREE TO BE RETAINED
 - TREE TO BE REMOVED
 - TREE CATEGORY BASED ON BS:5837 2012 CRITERIA
 - DECIDUOUS TREE CANOPY
 - EVERGREEN TREE CANOPY
- 01 TABLES BS 5837-2012

Client:	C/o Todd Architects
Project:	Tree survey for the proposed development at Cuirt Na Coiribe, Co.Galway.
Drawing Title:	Tree Constraints - Cuirt Na Coiribe

Client:	C/o Todd Architects
Project:	Tree survey for the proposed development at Cuirt Na Coiribe, Co.Galway.
Drawing Title:	Tree Constraints - Cuirt Na Coiribe
Drawn By:	HR
Checked By:	MG
CD File:	CNC-TS-001
Date:	22/10/18
Scale:	1:500@A1
Issued For:	Information
Rev:	-

North Arrow

Athor Care

Unit 10, Crossajale Enterprise Centre

Ballysmission Road

Limerick

Ireland

Phone: +353 (0)863083808

Fax: +353 (0)61400321

Web: www.athorcare.ie


Architectural Association of Ireland

Chartered Architectural Association

Chartered Architectural Association

Chartered Architectural Association

Tree #	Species Botanical Name	Age Class	Size ² (mm)	Crown ³ Sp.(M)	Crown ⁴ CL(M)	Condition ⁵	Structural/Physiological Observations & PMR	Impact of Development	Remedial works	Category ⁶	R.P.A. Meters (radius)
7423 x2	FRAXINUS excelsior Purple plum	SM	130	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7424	Prunus	SM	200	4	N=2 S=2 E=2 W=2	1.5	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7425	Acer campestre	Y	90	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y maple displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7426 x2	Betula pendula	Y	90	4	N=1 S=1 E=1 W=1	1	Good	Represents two young birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7427	Silver birch	Y	90	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7428	Norway maple	M	75	3	N=5 S=5 E=5 W=5	1	Poor	Two Y maples that have died	Remove to accommodate the development	Remove	U
7429	Cherry	SM	210	4	N=2 S=2 E=2 W=2	1.5	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7430	Fielc maple	Y	90	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y maple displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7431 x3	Fraxinus excelsior	SM	240	8	N=2 S=2 E=2 W=2	1.5	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7432	Birch	Y	90	6	N=1 S=1 E=1 W=1	2	Good	Represents a Y birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7433 x2	Purple plum	SM	130	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7434 x3	Norway Maple	SM	120	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM maples displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7435 x2	Purple plum	SM	130	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM Cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7436 x3	Norway Maple	SM	120	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM maples displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7437	Cherry	Y	180	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7438	Fielc maple	Y	90	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y maple displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7439 x3	Birch	Y	90	6	N=1 S=1 E=1 W=1	1	Good	Represents three Y birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7440 x3	Cherry	Y	10	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y cherry displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7441	Birch	Y	90	6	N=1 S=1 E=1 W=1	1	Good	Represents three Y birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7442	Cherry	SM	280	4	N=1 S=1 E=1 W=1	1	Fair	Represents a SM Cherry displaying a fair condition. It has been heavily over pruned. Due to their small size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7443	Sycamore	SM	280	6	N=1 S=1 E=1 W=1	1	Poor	Represents a SM Cherry displaying a fair condition. It has been heavily over pruned. Due to their small size they are ready to be replaced.	Remove to accommodate the development	Remove	U
7444 x3	Birch	Y	90	6	N=1 S=1 E=1 W=1	1	Good	Represents three Y birch displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7445	Norway maple	SM	180	4	N=1 S=1 E=1 W=1	1	Good	Represents a SM maple displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2
7446 x5	Fielc maple	Y	120	6	N=1 S=1 E=1 W=1	1	Good	Represents a group of young trees displaying a good overall condition	Remove to accommodate the development	Remove	C2
7447 x3	Cherry	Y	10	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y cherry displaying a good condition	Remove to accommodate the development	Remove	C2
7448 x3	Cherry	Y	10	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y cherry displaying a good condition	Remove to accommodate the development	Remove	C2
7449 x3	Cherry	Y	10	4	N=1 S=1 E=1 W=1	1	Good	Represents a Y cherry displaying a good condition	Remove to accommodate the development	Remove	C2
7450 x3	Norway Maple	SM	120	6	N=1 S=1 E=1 W=1	1	Good	Represents a SM maples displaying a good condition. Due to their size they are ready to be replaced.	Remove to accommodate the development	Remove	C2

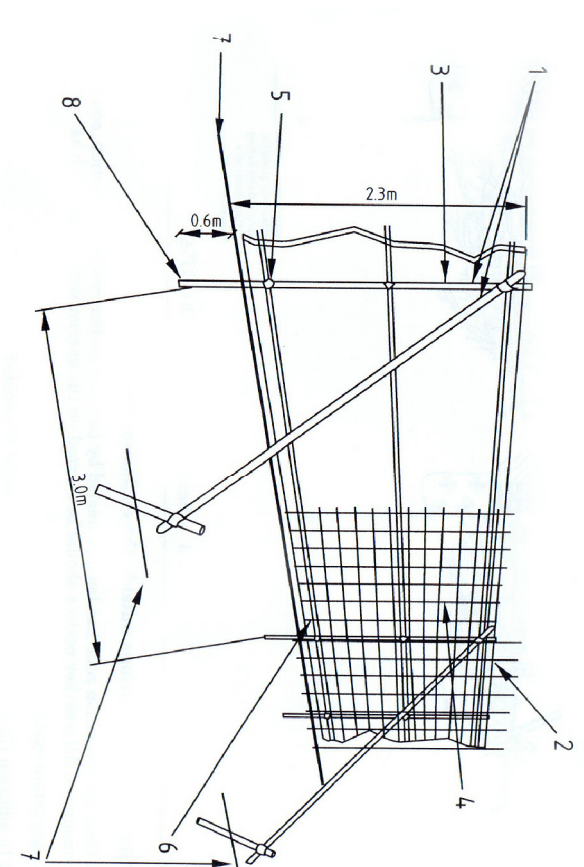

- Standard scaffold poles
- Uprights to be driven into the ground
- Panels secured to uprights with wire ties and where necessary standard scaffold poles
- Wire mesh wired to the uprights and horizontals
- Standard clamps
- Wire twisted and secured on the inside of fencing to avoid easy dismantling
- Ground level
- Approx. 0.6m driven into the ground

The above displays an example of a suitable protective barrier as recommended by BS 5837 2012 *Trees in Relation to Construction*

Notes

Please refer to Table 1 'Cuirt Na Coiribe' when reading this plan.

Do not scale

